WASHINGTON STATE HISTORIC COUNTY COURTHOUSE ASSESSMENT





PREPARED FOR THE WASHINGTON STATE OFFICE OF ARCHAEOLOGY AND HISTORIC PRESERVATION

JUNE 2003



Washington State Historic County Courthouse Assessment

Summary

Artifacts Consulting, Inc. is pleased to present the findings from the Historic County Courthouse Assessment in Washington State. The primary charges in the project were to provide an initial estimate of the costs associated with rehabilitation of the buildings and to offer a basic catalog of physical needs for each property.

During the assessment, broad spectrums of building types and overall conditions were encountered. Without exception, courthouses stand among the most prominent landmarks in their respective county seat towns and cities. With very few exceptions, the historic courthouses continue to serve as the judicial and criminal justice centers for their counties and the courtrooms continue in active use. Most of the historic courthouses also continue to serve as the seats of county government, housing government offices such as assessor, auditor, commissioner and executive. It is not atypical to also find sheriff's offices and public safety headquarters in the courthouses, as well as prosecuting attorneys, judicial chambers, law libraries, and occasionally, jails.

In Washington's 39 county seats, 28 courthouses appear to meet the criteria for consideration as historic buildings. A more detailed description of the criteria used in determining eligibility follows on page 3. The physical assessment of all the historic buildings indicated that 27 of the structures have unfunded capital improvement needs. The total estimated cost for needed to improvements to all of the historic courthouses is \$93,495,000.00.

A building-by-building summary of physical conditions and capital improvement needs is provided in the database section of this document. It should be noted that significant investments in stewardship have been made in all of the counties that have historic courthouses. Factors such as building age and maintenance, climatic variations across the state, county resources and population all affect the condition of Washington's historic courthouses as of 2003. While there is generally a proud and dignified character to the public landmarks, it is clear that they do not uniformly reflect an elevated state of preservation as functional historic places.



Assessment Methodology

To organize the physical and documentary information assembled on each property, a Microsoft Access database was developed for the Historic County Courthouse Assessment. Data on each building was assembled on written forms, and digital photographs were made using Sony Mavica digital cameras (MVC FD83/MVC-FD95 recording at 2.1 Meg resolutions). The data was then entered into the computer database to provide a searchable catalog of architectural, financial and visual information about each historic county courthouse.

Information about each courthouse was collected through site visits, phone interviews and written and architectural reports provided by the counties. Historical research information used for establishing historic building status and to confirm architectural condition issues was assembled from public records and historic photographs in the counties, the Washington State Archives, the Washington State Historical Society, various county historical society websites and particularly the recent book by Ray Graves, *Washington State's Historical Courthouses*, 2002. Elfin Cove Press. ISBN: 0944958-26-5.

Concurrent with the collection of on-site field data by Artifacts staff, a contact person was established in each of the historic courthouse counties, usually a facilities manager or public works director, but in some cases an elected official or knowledgeable designate. In most cases, a preliminary phone conversation was followed by a mailing that introduced and explained the project and provided a form summarizing the information needed on each courthouse. Detailed phone interviews were then conducted with the county contacts after they had assembled the requested information and prepared for the interview. In a few counties, the requested information was provided in writing. Where capital facilities plans or needs assessments already existed, that information was included in the report with cost estimates exactly as provided. Follow-up conversations were also held by phone or in person regarding some of the larger, more complex buildings or where additional information was needed.

Architectural Additions and Annex Facilities

With very few exceptions, such as Garfield and Columbia Counties, Washington's historic courthouses have been physically impacted by the addition of nearby or attached annex structures, wing additions or public safety facilities. These architectural additions are typically attached on the rear or secondary elevations of the historic buildings and do not dramatically alter the architectural character or integrity of the landmark courthouses. In a few cases, such as Snohomish County, the new additions are much larger in scale than the original historic buildings, and consequently new entries have been established and the



general orientation and interior flow of the historic building has been significantly changed. The additions and attendant parking lots also impact the typical siteing and landscape design that accompany many of the historic courthouses.

The historic courthouses fall broadly into three size categories, the smallest being 16,000 square feet or less (5 examples), the mid-scale ranging between 16,000 and 30,000 square feet (11 examples), and the largest containing more than 30,000 square feet (12 examples).

Criteria for Inclusion of Historic Courthouses

All thirty-nine courthouses in Washington State were evaluated for inclusion in this Historic County Courthouse Assessment using the criteria for eligibility for the Washington State Heritage Register and the more stringent National Register of Historic Places. The broad criteria for inclusion required that each building:

- be at least 50 years old,
- have retained its original design integrity and remain in its original historical context,
- be publicly owned and remain as the active county seat of government.

Twenty-nine of the county courthouses in Washington were fully documented in this project and a cost figure determined for rehabilitation and restoration.

Condition Assessment

The respective condition of each building and the identification of needed repair and restoration work were based upon facility condition reports and capital project planning reports provided by each county. The majority of the counties provided clear and complete information on building conditions and needed improvements, but many did not have current cost estimates for identified needed repairs and upgrades.

Artifacts staff developed cost estimates for needed work based upon the site visits and general assessment of physical needs for each courthouse. Using square footage and building dimensions, estimates were extrapolated for common improvements such as re-roofing, exterior masonry restoration and cleaning, HVAC upgrades and interior repair and rehabilitation. Where specialized needs were identified, such as window restoration or repair to decorative finishes such as marble or terrazzo, recent costs incurred on public buildings like the Washington State Legislative Building were used to estimate the scale and expense of the needed work. Because we have actual costs from



recent or ongoing rehabilitation projects on various sized courthouses, it was also possible to use a comparative method to confirm cost estimates.

The cost estimates are not corrected for the localized cost of materials and labor. The costs also do not consider the availability of specialized craftsmen and restoration services within their immediate areas. In some cases, the methods for rehabilitation recommended by the local project planners conflicted with the Secretary of Interior's Standards for Rehabilitation. This was discussed with some of the local representatives and the cost estimates in this report reflect alternative methods that do comply with the historic preservation standards.

Some of the courthouses have been altered with modifications that diminish their historic characters and appearances In cases where these modifications can be reversed and the serviceability of the building improved, a cost was developed for "restoration recovery."

Several courthouses had no specific plans for upgrade or rehabilitation but clearly were in need of basic interior industrial cleaning, painting and general repair. Cost estimates for general repair throughout, including paint or woodwork refinishing, was based on a \$10 per square foot extrapolation. A more intense rehabilitation cost that would include some light construction, partition wall reconfiguration or building system replacement throughout was based upon a \$25 per square foot figure.

The following table lists the historic courthouses documented as to conditions and needs for this project. Their respective dates of construction, landmark designations and square footages are shown followed by the estimates of cost for needed rehabilitation work.



County Courthouse Cost Assessment Summary Revised Version, August 25, 2003

County	Date of Construction	Historic	Square Footage	Estimated Cost of Needed Work	Estimated Cost of Historic Preservation Elements
Adams	1941	No		\$0.00	\$0.00
Asotin		No	25,000	\$0.00	\$0.00
Benton	1926	Yes	20,000	\$460,000.00	\$210,000.00
Chelan	1924	Yes	32,000	\$0.00	\$0.00
Clallam	1914	Yes	22,000	\$300,000.00	\$200,000.00
Clark	1940	Yes	82,000	\$4,500,000.00	\$2,450,000.00
Columbia	1887	Yes	15,330	\$25,000.00	\$15,000.00
Cowlitz*	1923	Yes	93,000	\$6,300,000.00	\$1,400,000.00
Douglas	1905 w/ 36 addition	Yes	43,000	\$500,000.00	\$350,000.00
Ferry	1936	Yes	10,593	\$435,000.00	\$365,000.00
Franklin	1912	Yes	27,874	\$1,500,000.00	\$1,500,000.00
Garfield	1901	Yes	11,330	\$2,000,000.00	\$1,250,000.00
Grant	1917	Yes	10,000	\$2,200,000.00	\$1,500,000.00
Grays Harbor	1910	Yes	33,500	\$1,000,000.00	\$500,000.00
Island	1948	Yes	20,485	\$0.00	\$0.00
Jefferson**	1892	Yes	31,390	\$30,000,000.00	\$15,000,000.00
King	1916, 1920	Yes		\$8,000,000.00	\$4,500,000.00
Kitsap	1949	No		\$0.00	\$0.00
Kittitas	1955	No		\$0.00	\$0.00
Klickitat	1941	Yes	24,180	\$280,000.00	\$280,000.00
Lewis	1927	Yes	50,000	\$1,000,000.00	\$400,000.00
Lincoln		No	12,000	\$0.00	\$0.00
Mason	1929	Yes	25,000	\$3,500,000.00	\$1,250,000.00
Okanogan	1913	Yes	29,650	\$4,200,000.00	\$2,000,000.00
Pacific	1910	Yes	25,000	\$100,000.00	\$100,000.00
Pend Oreille	1915	Yes	24,000	\$150,000.00	\$125,000.00
Pierce		No		\$0.00	\$0.00
San Juan	1906	Yes	5350	\$200,000.00	\$200,000.00
Skagit	1924	Yes	45,000	\$610,000.00	\$500,000.00
Skamania	1949	No	36,000	\$0.00	\$0.00

County	Date of Construction	Historic	Square Footage	Estimated Cost of Needed Work	Estimated Cost of Historic Preservation Elements
Snohomish	1897/1911	Yes	48,000	\$9,300,000.00	\$6,500,000.00
Spokane	1895	Yes	114,847	\$15,000,000.00	\$6,000,000.00
Stevens	1938	Yes	28,740	\$515,000.00	\$265,000.00
Thurston		No		\$0.00	\$0.00
Wahkiakum	1921	Yes	10,800	\$100,000.00	\$100,000.00
Walla Walla	1915	Yes	30,000	\$1,120,000.00	\$625,000.00
Whatcom		No		\$0.00	\$0.00
Whitman	1955	No	36,000	\$200,000.00	\$200,000.00
Yakima		No		\$0.00	0.00
TOTAL		Yes		\$93,495,000.00	\$47,785,000.00

* The Cowlitz County Courthouse has been remodeled into an administrative office building and is no longer used as the County courthouse. Rehabilitation cost figures relate to additional remodeling for office use.

**Jefferson County has also developed an estimate that includes a "base isolation" method of seismic upgrading for the building. The regional rarity and lack of reference material related to the use of this method on historic masonry buildings made it difficult to assess. Based on Jefferson County cost estimates, a rehabilitation of the courthouse employing the base isolation method would be \$40,000,000.

Name:		IS COUNTY COURTHOU	Date of Construction: 1941	
Location:	210 W	/ Broadway, Ritzville, WA 9	Historic 🗌 Non-Historic 🗹	
Contact Pers	on:	Bill Johns, County Engine	eer	
Contact Pho	ne:	(509) 659-3289	Contact Email:	
Contact Add	ress:	165 North 1st Avenue, O	thello, WA 99344	
Site Informat	ion:			

UTM References:	Quadrant Name: Ritzville	Zone: 11	Scale:	1:25,000	
	Easting: 395238E	Northing: 52200	25N	Datum:	NAD27
GPS Refences:	Latitude: 47.1274N	Longitude:	118.3812W		
Construction Type:					

Square Footage:	EQ Zone: 2	Date of Last Major Rehab:	1985
General Condition:			
Eventer Well maintained	Louisely, interstation of the		

Excellent. Well maintained. Largely intact historic fabric.

Type of Last Major Rehab Work:

Remodeled courtrooms and offices. Windows have been replaced.

General Description of Needed Work:

None. Fund and budget for maintenance.

Estimated Cost of Needed Work: \$0.00

Name:	ASOTI	TIN COUNTY COURTHOUSE				Date of	Date of Construction:		
Location:	135 2n	d Street, Asotir	n, WA 99402			Historic	: 🗌 Non	-Historic 🔽	
Contact Pers	on:								
Contact Phor	ne:		<u>C</u>	ontact Em	<u>ail:</u>				
Contact Addr	ress:								
Site Informat	ion:								
		I buildings were Idition attached							
UTM Referen	ces:	Quadrant Nar	ne: Asotin			Zone: 11	Scale:	1:25,000	
		Easting: 496	158E	Northing:	513160)8N	Datum:	NAD27	
GPS Refence	<u>es:</u>	Latitude: 46	.3400N	Lon <u>c</u>	jitude:	117.0499W			
Construction	Type:	1907 brick cor	nmercial build	ling. 1930's	stone fa	açade on 2nd	Street.		
Square Foota	age:	25,000	EQ Zone:	2	Date	of Last Major	Rehab:	2002	

General Condition:

Recently remodeled. Vinyl windows. Mixture of historic and new construction.

Type of Last Major Rehab Work:

Rear addition in 2002.

General Description of Needed Work:

Interior office renovation.

Estimated Cost of Needed Work: \$0.00

ASOTIN COUNTY



PRIMARY FACADE.



EXTERIOR NEW FACADE.



INTERIOR CORRIDOR.



Name:	BENT		DUSE	Date of Construction: 1926	
Location:	620 N	larket Street, Prosser, WA	A 99350	Historic 🗹 Non-Historic 🗌	
Contact Pers	son:	Susan Tanska, Facilitie	s Director		
Contact Pho	ne:	(509) 783-3118	Contact Email:	susan.tanska@co.benton.wa.us	
Contact Add	<u>ress:</u>	7320 West Quinault Avenue, Kennewick, WA 99336			
Site Informa	tion:				

Level area, sited between commercial business/downtown area on N and NE sides and residential on two remaining sides. Courthouse occupies entire city block.

UTM References:	Quadrant Name: Prosser	Zone: 11	Scale: 1:25,000	
	Easting: 286354E	Northing: 5120157N	Datum: NAD27	
GPS Refences:	Latitude: 46.2034N	Longitude: 119.7693W		
Construction Type:	Concrete frame with brick veneer having either terra cotta or cast stone detailing. Some interior plaster walls remain and portion of original terrazzo flooring. Modern addition on rear and new main entrance between old and new buildings.			

Square Footage: 20,000 EQ Zone: 2 Date of Last Major Rehab: 1986-1987

General Condition:

Good. Ground water table is high, but no major problem yet. All maintenance is done in house by facility persons.

Type of Last Major Rehab Work:

1986 interior rehabilitation. Left original stairway. Reconfigured spatial partitions, finishes and materials. Reason for rehab was to provide additional office space and upgrade existing office spaces. Of three original court rooms, two were remodeled into offices. One remains that was not renovated other than new carpeting and windows. Exterior windows were replaced with bronze metal. New entrance was added with ADA access. Old entry is now a side door. Seismic stabilization was included in rehab involving strengthening of existing systems. HVAC was upgraded and 68 new heat pumps added to replace gas furnace. Electrical was upgraded throughout building. New addition to building totaling 10,000 sq.ft. In 1993-1994, building was reroofed.

General Description of Needed Work:

They do have a capital facilities plan. Additional office space is needed to consolidate county services under one roof 60K. Structural upgrades, particularly to roof to enable mechanical equipment on roof rather than limited to penthouse 150K. New mechanical equipment, particularly the chiller, which they would like to have placed on the roof 250K.

Estimated Cost of Needed Work: \$460,000.00

WASHINGTON STATE HISTORIC COURTHOUSE ASSESSMENT

BENTON COUNTY



EXTERIOR ANGLE.



MAIN ENTRANCE DETAIL.



INTERIOR STAIR DETAIL.



<u>Name:</u>	CHEL		Date of Construction: 1924			
Location:	350 C	orondo Avenue, Wenatche	Historic 🗹 Non-Historic 🗌			
Contact Pers	<u>son:</u>	Patrick DuLac/Cathy Mulhall, County Executive				
Contact Pho	ne:	(509) 667-6233	Contact Email:	patrick.dulac@co.chelan.wa.us		
Contact Add	ress:	350 Orondo Avenue, Wenatchee, WA 98801				
Site Informa	tion:					

In downtown. Courthouse sits on elevated site with lawn/park landscaping on front. Criminal justice annex attached on north side quarter of building.

UTM References:	Quadrant Name: Wenatch	ee	Zone: 10	Scale:	1:25,000
	Easting: 702742E	Northing: 52554	02N	Datum:	NAD27
GPS Refences:	Latitude: 47.4225N	Longitude:	120.3120W		
Construction Type:	Post & beam with brick fac	ade			

Square Footage:	32,000	EQ Zone: 2	Date of Last Major Rehab: 2003
-----------------	--------	------------	--------------------------------

General Condition:

Excellent. Very large formal well maintained example with white mable walls, floors and colums on the ground floor and primary corridors. Windows have been replaced on all elevations excluding the arched formal windows on the third floor.

Type of Last Major Rehab Work:

89 and 97 Capital Facilities Plans. Michael Beamann, Architect, Spokane.

General Description of Needed Work:

Current capital facilities plan provides cost estimate

Estimated Cost of Needed Work: \$0.00

CHELAN COUNTY



REAR FACADE.



MAIN ENTRANCE DETAIL.



INTERIOR DETAIL.



Name:	CLAL		RTHOUSE	Date of Construction: 1914
Location:	223 E	ast 4th Street, Port Ar	ngeles, WA 98362	Historic 🗹 Non-Historic 🗌
Contact Pers	<u>ion:</u>	Joel Winborn/Parks,	Fair,Building Divison Manager	
Contact Pho	ne:	(360) 417-2429	Contact Email:	
Contact Add	ress:	PO Box 863, Port Ar	ngeles, WA 98362-0149	
Site Information	tion:			
0.14			. Charles and the strength of	

Sits on a hill, up hill from downtown. Three floors including basement and an addition of 800 sq. ft. New ja and sheriff offices added to rear and connected by enclosed bridge.

UTM References:	Quadrant Name: Port Angeles		Zone: 10	Scale:	1:25,000
	Easting: 467862E	Northing: 53290	52N	Datum:	NAD27
GPS Refences:	Latitude: 48.1159N	Longitude:	123.4318W		
Construction Type:	Masonry, brick				

Square Footage:	22,000	EQ Zone: 3	Date of Last Major Rehab:	1999
-----------------	--------	------------	---------------------------	------

General Condition:

Good to excellent. Structural upgrade. Interior lobby organized around open rotunda with balcony surrounding and leaded glass skylight in ceiling. Faux painted plaster in light marble design is excellent on ground floor and stairway.

Type of Last Major Rehab Work:

1999 replaced all windows, repointed brick, refurbished courtrooms and atrium, upgraded electrical, recarpeted/repainted, refinished furniture, restored spagliola in atrium, plaster based. 2003 rebuilt boiler.

General Description of Needed Work:

Have a capital facilities plan. Floor settled, carpet needs to be replaced, maintenance, needs exterior cleaning.

Estimated Cost of Needed Work: \$300,000.00

CLALLUM COUNTY



PRIMARY FACADE.



MAIN ENTRANCE DETAIL.



LOBBY DETAIL.



Name:	CLAR		URTHOUSE		<u>Date o</u>	f Construction: 1940
Location:	1200	Franklin Street, V	nklin Street, Vancouver, WA 98660			ic 🗹 Non-Historic 🗌
Contact Pers	son:	Darrel Stump				
Contact Pho	ne:	(360) 397-2238	3 <u>c</u>	Contact Email:	darrel.stump@	clark.wa.gov
Contact Add	ress:					
Site Informa	tion:					
		Sheet metal-cla s. Five floors wit		or HVAC and e	evators rear eleva	ation. Building complex
·	,					
UTM Referer	nces:	Quadrant Nan	ne: Vancouve	er	Zone: 10	Scale: 1:25,000
		Easting: 5252	276E	Northing: 50	52817N	Datum: NAD27
GPS Refence	<u>es:</u>	Latitude: 45.	6304N	Longitu	de: 122.6757W	
Construction	n Type:	Concrete				
Square Foot	age:	82,000	EQ Zone:	2 [Date of Last Majo	or Rehab: 2003

General Condition:

Original decorative terazzo floors. Original basic floor plan. Late deco brass work. Original marble wainscotting. Ceilings dropped. Windows have been replaced. Exterior painted concrete is in good condition.

Type of Last Major Rehab Work:

Currently adding four courtrooms, remodeling the Clerk's and District Court areas, thorough renovation and adding a third elevator \$5.4 million.

General Description of Needed Work:

Seismic retrofit.

Estimated Cost of Needed Work: \$4,500,000.00

CLARK COUNTY



PRIMARY FACADE.



MAIN ENTRANCE DETAIL.



INTERIOR CORRIDOR DETAIL.



Name:	COLU	IMBIA COUNTY COURTHO	OUSE	Date of Construction: 1887			
Location:	341 E	ast Main Street, Dayton	Alain Street, Dayton Historic 🗹 Non-Historic				
Contact Person: Charles Reeves, Dana Martin Commissioners							
Contact Phone:		(509) 382-4542	(509) 382-4542 <u>Contact Email:</u> dana_martin@co.columbia.wa.us				
Contact Address: 341 East Main, Dayton, WA 99328							
Site Information	tion:						
Center of town. Flat square site. Spoke on site with facilities staff, Dave Finney							
<u>UTM Referer</u>	<u>ices:</u>	Quadrant Name: Dayton		Zone: 11	Scale: 1:25,000		
		Easting: 424763E	Northing: 512	29972N	Datum: NAD27		

GPS Refences:	Latitude: 46.3211N	Longitude: 117.9773W
Construction Type:	Stone masonry, stucco exterior,	wood frame inside

Square Footage:	15.330	EQ Zone: 2	Date of Last Major Rehab:	1991-93
	10,000			1001 00

General Condition:

Excellent. Perhaps the best restored small courthouse in the state. A thoughful restoration of exterior, interior and grounds was conducted in 1991-93 including restored wood windows, exterior patching and paint, new roof, restored statuary.

Type of Last Major Rehab Work:

Full restoration. Exterior and interior. 6.8 million, 1991-93. Courtroom furniture was altered in orientation and book shelves added on side walls

General Description of Needed Work:

Minor mold and moisture invasion problem in stone foundation wall basement. 10K

Estimated Cost of Needed Work: \$25,000.00

COLUMBIA COUNTY



PRIMARY FACADE.



COLUMN DETAIL.



INTERIOR STAIRWAY.



Name:	cow	LITZ COUNTY COURTHO	Date of Construction: 1923	
Location:	207 N	lorth 4th, Kelso, WA 9862	Historic 🗹 Non-Historic 🗌	
Contact Pers	son:	Dwight Herron, Maintena	nce Manager	
Contact Pho	one:	(360) 577-3174	Contact Email:	
Contact Add	ress:	207 North 4th, Kelso, WA	A 98626	
Site Informa	tion:			

Remodeled as County administration building. No courtrooms. In downtown Kelso on a hill. Bedrock below surface, very stable site, survived several earthquakes with little damage.

UTM References:	Quadrant Name: Kelso	Z	one: 10	Scale:	1:25,000
	Easting: 507131E	Northing: 51099971	N	Datum:	NAD27
GPS Refences:	Latitude: 46.1455N	Longitude: 12	22.9077W		
Construction Type:	Brick with cut stone. Reinfo	orced concrete and ste	eel with bricl	k façade.	

Square Footage:	93,000	EQ Zone: 3	Date of Last Major Rehab:	1976
-----------------	--------	------------	---------------------------	------

General Condition:

1920's-30's--buildings are joined together and need further lateral support. Marble on walls/deco railings/some corridor and stair detail original.

Type of Last Major Rehab Work:

Blueprints on file/Georgian Revival. Addition in 1930's. Annex in 1940's. Windows replaced. 1976--Majo rehab, gutted building systems and updated plumbing, HVAC, electrical. Mid 80's--New windows. 1999--"weatherproofed" brick. 2002--New roof on building and annex.

General Description of Needed Work:

Working on capital facilities plan. Need earthquake retrofit, HVAC, electrical, plumbing update, duct replacement, chiller and cooling tower replacement, heating boiler replacement, replace power transformer, update fire alarm, update elevator, replace skylight, Need \$1.1 million for general projects and \$4.9 million for seismic upgrades, preservation standards improvements & recovery of lost character defining features \$300K.

Estimated Cost of Needed Work: \$6,300,000.00

COWLITZ COUNTY



PRIMARY FACADE.



MAIN ENTRANCE DETAIL.



LOBBY DETAIL.



Name:	DOUG	GLAS COUNTY COURTH	Date of Construction: 1905		
Location:	213 S	outh Rainier, Waterville,	Historic 🗹 Non-Historic 🗌		
Contact Pers	ct Person: Jim Barker, Dir of Transp & Land Services/Co Administrator				
Contact Pho	ne:	(509) 884-7173	Contact Email:		
Contact Add	ress:	140 NW 19th Street, Ea	ast Wenatchee, WA 98802		
Site Informa	tion:				
Mission style influenced stone and brick historic building on hillton site with Art Deco style addition to the					

Mission style influenced stone and brick historic building on hilltop site with Art Deco style addition to the rear and new criminal justice facility to the south. Parking at rear. Lawn site with tree canopy at front.

UTM References:	Quadrant Name: Watervil	le Zone: 10	Scale: 1:25,000		
	Easting: 720273E	Northing: 5280970N	Datum: NAD27		
GPS Refences:	Latitude: 47.6466N	Longitude: 120.0671W			
Construction Type:	Brick and stone with reinforced concrete addition				

Square Footage:	43,000	EQ Zone: 2B	Date of Last Major Rehab:	2001-2002
-----------------	--------	-------------	---------------------------	-----------

General Condition:

Good to excellent. Rusticated stone ground floor base with red brick masonry on upper floors. Timber frame open tower. Interior woodwork, doors, stair rails and casings intact. Courtroom intact and used. Furniture partially original.

Type of Last Major Rehab Work:

Added 7300 sq.ft. to south side and refurbished four historic floors. New electric, HVAC, added elevator, ADA, new windows, fire sprinklers, seismic, re-roofed. Cost of completed rehab=\$2 million.

General Description of Needed Work:

General preservation recovery, 500K.

Estimated Cost of Needed Work: \$500,000.00

DOUGLAS COUNTY



PRIMARY FACADE.



ART DECO ADDITION.



LOBBY DETAIL.



Name:	FERR	Y COUNTY COURT	Date of Construction: 1936		
Location:	350 E	ast Delaware Street,	, Republic, WA 99166	Historic 🗹 Non-Historic 🗌	
Contact Pers	on:	David Wermuth, Fa			
Contact Pho	ne:	(509) 775-5247	Contact Email:	davidwermuth@hotmail.com	
Contact Add	ress:				
Site Information:					
On a hill above town. Art Deco building. Engineered by Grand Coulee Dam designer.					

UTM References:	Quadrant Name: Republic	Zone: 11	Scale: 1:25,000
	Easting: 372383E	Northing: 5389707N	Datum: NAD27
GPS Refences:	Latitude: 48.6494N	Longitude: 118.7326W	
Construction Type:	Reinforced concrete with st	ucco over.	

Square Footage:	10,593	EQ Zone: 2	Date of Last Major Rehab:	1992
-----------------	--------	------------	---------------------------	------

General Condition:

Footprint 3531/75x50. Good. Woodwork/interior original. Carpeted. Vinyl windows. Original metal in basement opening. Suspended ceilings & light fixtures.

Type of Last Major Rehab Work:

Windows in 1992.

General Description of Needed Work:

Re-roofing 40K. Boiler and retrofit radiators 70K. Clean and repaint exterior 25K. Lighting fixture retrofit 20K. Interior rehabilitation 280K.

Estimated Cost of Needed Work: \$435,000.00

FERRY COUNTY



PRIMARY FACADE.



MAIN ENTRANCE DETAIL.



LOBBY DETAIL.





Name:	FRAN	IKLIN COUNTY COUR	THOUSE	Date of Construction: 1912	
Location:	1016	N Fourth Avenue, Pasc	o, WA 99301	Historic 🗹 Non-Historic 🗌	
Contact Person: Elmer Schuman/Fred Bowen, County Administrator			r		
Contact Pho	ne:	(509) 545-3578	Contact Email:		
Contact Address: PO Box 1451, Pasco, WA 99301 (1016 N 4th Avenue)			enue)		
Site Information:					
lail and criminal justice center attached on rear. I awn site with trees & landscaped site facing large city					

Jail and criminal justice center attached on rear. Lawn site with trees & landscaped site facing large city park.

UTM References:	Quadrant Name: Pasco		Zone: 11	Scale:	1:25,000
	Easting: 338525E	Northing: 512230	1N	Datum:	NAD 27
GPS Refences:	Latitude: 46.2371N	Longitude:	119.0943W		
Construction Type:	Concrete, steel & wood. decorative plaster.	Brick masonry/terra co	otta. Faux ma	arble inte	rior with

Square Footage: 27,874 EQ Zone: 2 Date of Last Major Rehab: None

General Condition:

Fair to poor. The historic building is historically intact with color scheme on the interior badly outdated. Overall condition consists of seriously deferred maintenance with accumulated dirt, deteriorating paint and metalwork. Original wood windows intact. Dome with interior leaded glass ceiling. 1/4 sawn oak woodwork. Rotunda/round floor plan.

Type of Last Major Rehab Work:

1999 feasability study. \$10.2 bond issue passed in 2002. 18 month construction rehab project underway. CKGT Cardwell architects. Jan-Feb bid opening.

General Description of Needed Work:

Mechanical, electrical, structural, plumbing, complete restoration upgrades. Work will begin soon funded by a local bond issue for \$10.2 million. Preservation support for unique restoration needs \$1.5 million.

Estimated Cost of Needed Work: \$1,500,000.00

FRANKLIN COUNTY



PRIMARY FACADE.



STAIR DETAIL.



DOME DETAIL.



Name:	GARF		OUSE	Date of Construction: 1901	
Location:	789 N	lain Street, Pomeroy, WA	99347	Historic 🗹 Non-Historic 🗌	
Contact Person: Dean Burton, County Commissione			mmissioner and Donna De	al, Auditor	
Contact Pho	ne:	(509) 843-1411	Contact Email:		
Contact Address:		PO Box 278, Pomeroy, V	VA 99347		
Site Information:					
Center of town on a raised site. Statuary monument on front green space. Rear parking lot. No attached buildings or wings.					

UTM References:	Quadrant Name: Pomeroy	Zone: 11	Scale:	1:25,000
	Easting: 455025E	Northing: 5146655N	Datum:	NAD27
GPS Refences:	Latitude: 46.4739N	Longitude: 117.5858W		
Construction Type:	Brick masonry on stone foundation.			

Square Footage:	11,330	EQ Zone: 2	Date of Last Major Rehab: 2	003
-----------------	--------	------------	-----------------------------	-----

General Condition:

Painted brick building sits on gracious raised site in downtown Pomeroy. The three story building is crisp white Victorian in character with two asymetrical towers and a gabled roof. The building retains its original windows, interior lobby woodwork and general floorplan. Main stair is Eastlake and intact. Elevator has been added on rear of building. Courtroom has original woodwork and furniture. Ceiling has been lowered with flourescent grid system.

Type of Last Major Rehab Work:

Recent capital facilities plan, 2-3 years old. Main electrical panel upgrade (1994-95). Jail in basement updated (2003). Elevator installation at rear, ADA, re-roofed building (2001).

General Description of Needed Work:

Heating/cooling system 100K. Window replacement or rehab 100K. Exterior stone and brick repair 60K. Copy of 1997 study of building with estimates and photos available.

Estimated Cost of Needed Work: \$2,000,000.00

GARFIELD COUNTY



PRIMARY FACADE.



REAR FACADE.



NEWEL DETAIL.



Name:	GRAM	IT COUNTY COURTHOUS	SE	Date of Construction: 1917
Location:	35 C \$	Street NW, Ephrata 98823	Historic 🗹 Non-Historic 🗌	
Contact Pers	son:	Vern Cummings, Courtho	ouse Facility Manager	
Contact Pho	ne:	(509) 754-2011	Contact Email:	
Contact Add	ress:	PO Box 37, Ephrata, WA	98823 (37 C Street)	
	_			

Site Information:

National register, arch. George H. Keith, Spokane (also designed Okanogan County Courthouse). Original 1909 courthouse nearby now used as community Methodist church. Both buildings still utilize geothermal heating systems drawing upon local hot springs.

UTM References:	Quadrant Name: Ephrata		Zone: 11	Scale:	1:25,000
	Easting: 307136E	Northing: 524388	36N	Datum:	NAD27
GPS Refences:	Latitude: 47.3220N	Longitude:	119.5522W		
Construction Type:	Concrete with brick exterior cornice. Two stories and b		ailing on pedi	ment, colı	umns and

Square Footage:	10,000	EQ Zone: 2	Date of Last Major Rehab:	1957
-----------------	--------	------------	---------------------------	------

General Condition:

Good

Type of Last Major Rehab Work:

1957 last upgrade, office remodel and annex added/no sprinklers, windows have been replaced with fixed casements.

General Description of Needed Work:

Exterior restoration including terra cotta restoration and repointing, repair to cornice and parapet walls and cap, masonry cleaning est. 500,000. Structural assessment and interior rehabilitation \$1 million. Upgrade mechanical and electrical/data systems \$700,000.

Estimated Cost of Needed Work: \$2,200,000.00

Name:	GRAY	S HARBOR COUNTY CO	URTHOUSE	Date of Cor	nstruction: 1910
Location:	100 W	/est Broadway Avenue, Mo	ontesano, WA 985	63 Historic 🗹	Non-Historic 🗌
Contact Pers	erson: Al Carter, Comm/Rose Elway, Budget Dir/Kevin Varness, Dir Util & Devel/Den Selberg, Facil Mgr			& Devel/Dennis	
Contact Phone:		(360) 249-3731	Contact Email:	Anne Sullivan/Paul B	Easter, Admin Bldg
Contact Address: 100 West Broadway S		100 West Broadway Suit	e 1, Montesano, W	A 98563	
Site Information:					
Building sits up on a hill in town, a block or two out of downtown.					

UTM References:Quadrant Name: MontesanoZone: 10Scale: 1:25,000Easting: 454385ENorthing: 5203093NDatum:NAD27GPS Refences:Latitude: 46.9818NLongitude:123.5998WConstruction Type:Sandstone

Square Footage:	33,500	EQ Zone: 2	Date of Last Major Rehab:	1999-2000
-----------------	--------	------------	---------------------------	-----------

General Condition:

Recent rehabilitation completed 2000.

Type of Last Major Rehab Work:

Restored entire building following earthquake. Restored murals, building systems, roof, repaired earthquake damage.

General Description of Needed Work:

Received a \$5000 grant and acquired loans to pay for the rehabilitation. Insurance will not cover as many expenses as originally thought. They would love assistance to repay loans. Behind the Courthouse is the County Jail Building which is unsafe and unoccupied. They would like to rehabilitate it also.

Estimated Cost of Needed Work: \$1,000,000.00



PRIMARY FACADE.



PEDIMENT DETAIL.

INTERIOR DETAIL.



Name:	ISLAN	ID COUNTY COURTHOU	Date of Construction: 1948		
Location:	1 NE ⁻	7th Street, Coupeville, WA	Historic 🔽 Non-Historic 🗌		
Contact Person: Bill Oakes, Public Works					
Contact Phone:		(360) 679-7331	Contact Email:		
Contact Address: PO Box 5000, Coupeville, WA 98239-5000		, WA 98239-5000			
Site Information:					
Upslope from historic downtown. View of Penn Cove.					

UTM References:	Quadrant Name: Coupe	Zone: 10	Scale: 1:25,000	
	Easting: 523464E	Northing: 53403	386N	Datum: NAD27
GPS Refences:	Latitude: 48.2182N	Longitude:	122.6841W	
Construction Type:	Mortar and stucco façad	e and brick façade. F	ormed concret	te construction.
Square Footage:	20,485 EQ Zor	ne: 3 Date	e of Last Majo	<u>r Rehab:</u> 2002

General Condition:

Good.

Type of Last Major Rehab Work:

2001 built new courthouse. 2002--added 8" of width to interior wall and steel stiffening during seismic retrofit. Remodeled office space. All new mechanical, electrical, HVAC. No exterior work (stucco crack).

General Description of Needed Work:

Exterior rehabilitation. Brick damage. Stucco and brick rehab. Repaint.

Estimated Cost of Needed Work: \$0.00

ISLAND COUNTY



PRIMARY FACADE.



MAIN ENTRANCE DETAIL.



SIDE FACADE DETAIL.



Name:	JEFF	ERSON COUNTY COURT	Date of Construction: 1892	
Location:	1820	Jefferson Street, Port Townsend, WA 98368 Historic ☑ Non-Historic		
Contact Pers	son:	Gordon Ramstrom, Arch Proj Coord/David Goldsmith, Co Administrator		
Contact Pho	ne:	(360) 385-9380	Contact Email:	gramstrom@co.jefferson.wa.us
Contact Add	ress:	PO Box 2070, Port Townsend, WA 98368 (1322 Washington Street)		

Site Information:

On a hill in uptown Port Townsend overlooking downtown. In front of a bluff in a residential neighborhood. Clear, open site with good drainage.

UTM References:	Quadrant Name: Port Townsend South		Zone: 10	Scale: 1:25,000
	Easting: 517393E	Northing: 53285	64N	Datum: NAD27
GPS Refences:	Latitude: 48.1121N	Longitude:	122.7663W	
Construction Type:	Unreinforced steam pressed brick masonry with Alaskan sandstone foundation. Interior masonry walls with plaster finish. Romanesque style.			

Square Footage:	31,390	EQ Zone: 3	Date of Last Major Rehab:	1990
-----------------	--------	------------	---------------------------	------

General Condition:

Reasonable condition for age. Needs restoration. Much of what was original remains intact, very little historic fabric has been impacted.

Type of Last Major Rehab Work:

Central boiler installed in 1930's. County jail converted to county office in early 80's. Courtroom updated in 80's. New slate and copper roof in early 90's. Has not received consistent maintenance over the years.

General Description of Needed Work:

EQ structural retrofit on clock tower (\$4 million). Courthouse upgrade, including seismic (base isolation), mechanical, electrical, plumbing, communications, exterior envelope including entries, windows, brick and stone masonry (\$35 million). If cautious base isolator approach to seismic upgrade is excluded (25 million). Courthouse grounds, including site drainage, accessibility, sidewalks, parking, lighting, site security (\$1 million).

Estimated Cost of Needed Work: \$30,000,000.00

JEFFERSON COUNTY



PRIMARY FACADE.



CORRIDOR DETAIL.



CLOCK MACHINERY.



Name:	KING	COUNTY COURTHOUSE		Date of Construction: 1916,
Location:	516 3	rd Avenue, Seattle, WA	98104	Historic 🔽 Non-Historic 🗌
Contact Pers	<u>ion:</u>	Kathy Brown, DES/Facilities Management, also tal Estate 206.808.7874		ked to Bob Wicklein, Seneca Real
Contact Pho	ne:	(206) 296-0631	Contact Email:	
Contact Address:		500 4th Avenue, Roor	n 800, Seattle, WA 98104	
Site Informat	tion:			
Fills large urban site with no landscaped grounds. The building is oriented toward a small park on the sour				toward a small park on the south

Fills large urban site with no landscaped grounds. The building is oriented toward a small park on the south.

UTM References:	Quadrant Name:Seattle SouthZone		Scale:	1:25,000
	Easting: 550428E	Northing: 5272131N	Datum:	NAD27
GPS Refences:	Latitude: 47.6026N	Longitude: 122.3291W		
Construction Type:	Reinforced concrete and steel with stone cladding.			

<u>Square Footage:</u>	EQ Zone: 3	Date of Last Major Rehab:	2002

General Condition:

Excellent with recent seismic upgrade completed.

Type of Last Major Rehab Work:

\$80 million retrofit underway currently. Comprehensive seismic, mechanical and life safety systems, exterior and cornice attachment & repointing, \$10 million emergency repair project was conducted following the Nisqually EQ in 2001.

General Description of Needed Work:

Formal lobby restoration. Elevators. Security. \$8 million

Estimated Cost of Needed Work: \$8,000,000.00

KING COUNTY



EAST AND NORTH SIDE FACADES.



WEST FACADE.



CORRIDOR DETAIL.



KITSAP COUNTY COURTHOUS	E	Date of Construction:	1949
614 Division Street, Port Orchard, WA 98366		Historic 🗌 Non-Histori	с 🗸
<u>on:</u>			
<u>1e:</u>	Contact Email:		
ess:			
ion:			
		on: ne: Contact Email: ress:	614 Division Street, Port Orchard, WA 98366 Historic Non-Histori on: he: Contact Email: ress:

UTM References:	Quadrant Name: Bremerto	n West	Zone: 10	Scale:	1:25,000
	Easting: 527319E	Northing: 52647	80N	Datum:	NAD27
GPS Refences:	Latitude: 47.5378N	Longitude:	122.6370W		
Construction Type:					
<u>Square Footage:</u>	EQ Zone:	3 Date	of Last Major	r Rehab:	

General Condition:

Type of Last Major Rehab Work:

General Description of Needed Work:

Estimated Cost of Needed Work: \$0.00

Name:	KITTITAS COUNTY COURTHOU	ISE	Date of Construction:	1955
Location:	205 West 5th Avenue, Ellensburg, WA 98926		Historic 🗌 Non-Histori	с 🗸
Contact Perso	on:			
Contact Phon	le:	Contact Email:		
Contact Addr	ess:			
Site Informati	on:			

UTM References:	Quadrant Name: Ellens	sburg	Zone: 10	Scale:	1:25,000
	Easting: 686425E	Northing: 52075	528N	Datum:	NAD27
GPS Refences:	Latitude: 46.9970N	Longitude:	120.5480W		
Construction Type:					
Square Footage:	EQ Zor	ne: 2 Date	e of Last Majo	r Rehab:	
General Condition:					

Type of Last Major Rehab Work:

General Description of Needed Work:

Estimated Cost of Needed Work: \$0.00

Name:	KLIC			JSE		Date of	Constructi	<u>on:</u> 1941
Location:	205 S	outh Columb	ous Avenue, Gold	lendale 98	620	Historic	c 🔽 Non-H	istoric 🗌
Contact Pers	son:	Larry Nick	olas, Facilities ma	anager				
Contact Pho	ne:		(Contact Em	ail:			
Contact Add	ress:							
Site Informat	tion:							
Native Art De large green s			nbright paint. C ng area.	orrections a	annex on re	ar quarter.	The building	faces a
UTM Referen	ices:	Quadrant	Name: Goldenda	ale	Zo	one: 10	Scale: 1:	25,000
		Easting:	669224E	Northing:	5076444N	1	Datum: N	NAD27
GPS Refence	es:	Latitude:	45.8228N	Long	gitude: 12	0.8216W		
Construction	n Type:	Concrete						
Square Foota	age:	24,180	EQ Zone:	2	Date of	Last Major	r Rehab: 2	002

General Condition:

Good/Excellent. Aluminum windows/appropriate but not original. New construction vestibule added at main enrty and lanterns added flanking entry on stairs. Interior light fixtures and main entry window intact. Courtroom largely intact with some original furniture.

Type of Last Major Rehab Work:

Exterior renovation 2002. HVAC completed 2002.

General Description of Needed Work:

Interior rehab. Convert jail to archives. Courtrooms need to be restored (\$280,000)

Estimated Cost of Needed Work: \$280,000.00

KLICKITAT COUNTY



PRIMARY FACADE.



MAIN ENTRANCE DETAIL.



WINDOW DETAIL.



Name:	LEWI	S COUNTY COURTHOUS	E	Date of Construction: 1927	
Location:	351 N	W North Street, Chehalis, \	WA 98532	Historic 🔽 Non-Historic 🗌	
Contact Pers	ion:	Doug Carey/Larry Keeton	i, Gen Admin Direc	tor, 360.740.2753/Rose Bowman	
Contact Phone:		(360) 740-1192	Contact Email:	ddcarey@co.lewis.wa.us	
Contact Address:		351 NW North, Chehalis,	WA 98532		
Site Information:					
One city block, approximately 3 miles south of downtown business district.					

UTM References:	Quadrant Name: Centralia	Zone: 10	Scale: 1:25,000
	Easting: 502448E	Northing: 5167356N	Datum: NAD27
GPS Refences:	Latitude: 46.6617N	Longitude: 122.9680W	
Construction Type:	Concrete frame, cast stone 3 stories w/mezzanine and I	& brick exterior, california stucco, basement	lath & plaster interior,

Square Footage:	50,000	EQ Zone: 3	Date of Last Major Rehab:	2001-2002
-----------------	--------	------------	---------------------------	-----------

General Condition:

Interior: Fairly good. Exterior: Poor--mortar and caulked joints are failing, attachment of masonry is questionable.

Type of Last Major Rehab Work:

Interior: HVAC/Electrical upgrade, additional elevation. Have a capital facilities plan--trying to implement in portions.

General Description of Needed Work:

Exterior renovation, EQ retrofit/upgrade, rehab/replication of historic brass doors and historic lighting fixtures.

Estimated Cost of Needed Work: \$1,000,000.00

Name:	LINCO	OLN COUNTY COURTHOU	Date of	Date of Construction:		
Location:	450 Lo	ogan Street, Davenport, Wa	99122	Historic	: 🗌 Non-Historic 🔽	
Contact Pers	on:	Shelly Johnston, Auditor				
Contact Pho	ne:	(509) 725-4971	Contact Email:			
Contact Add	ress:	PO Box 28, Davenport, W	A 99122			
Site Informat	ion:					
Building was o	destroye	ed in a fire in 1995. It was c	ompletely reconstructed	using origir	nal design.	
UTM Referen	ces:	Quadrant Name: Davenp	port Ze	one: 11	Scale: 1:25,000	
		Easting: 413801E	Northing: 5278308	N.	Datum: NAD27	

Easting: 413801ENorthing: 5278308NDatum: NAD27GPS Refences:Latitude: 47.6544NLongitude: 118.1479WConstruction Type:Concrete and brick masonry.

Square Footage:	12,000	EQ Zone: 2	Date of Last Major Rehab:
-----------------	--------	------------	---------------------------

General Condition:

Freshly reconstructed with all new interior and exterior materials.

Type of Last Major Rehab Work:

General Description of Needed Work:

Estimated Cost of Needed Work: \$0.00

Name:	MASC	ON COUNTY COUF	RTHOU	SE	Date of Construction: 1929		
Location:	419 N	orth 4th, Shelton, V	VA 985	84	Historic 🗹 Non-Historic 🗌		
Contact Pers	son:	Mike Rutter, Capital Facilities					
Contact Pho	ne:	(360) 427-9670 540 <u>Contact Email:</u>			mr@co.mason.wa.us		
Contact Add	ress:	PO Box 1850, Sh	elton, V	VA 98584			
Site Informat	Site Information:						
Square block on lawn site. Jail attached on south side.							

UTM References:	Quadrant Name: Shelton	Zone: 10	Scale:	1:25,000
	Easting: 492247E	Northing: 5228956N	Datum:	NAD27
GPS Refences:	Latitude: 47.2160N	Longitude: 123.1024W		
Construction Type:	Reinforced concrete. Tenir			

Square Footage:	25,000	EQ Zone: 3	Date of Last Major Rehab:	1995
-----------------	--------	------------	---------------------------	------

General Condition:

Fair to good. Original wood windows intact/metal on south.

Type of Last Major Rehab Work:

Re-roofing and earthquake stabilization in 1995. Have done some interior remodeling over the years to accommodate different departments. Granite main steps were reset after the Nisqually earthquake. Entry doors replaced with aluminum.

General Description of Needed Work:

Spalling exterior stone restoration/needs cleaning. Interior rehabilitation, including HVAC, plumbing, electrical, courtroom remodeling. Would like to reinstall historic doors and repair or replace historic windows. Tried for a bond issue of \$3.5 million for courthouse rehab a few years ago which didn't pass.

Estimated Cost of Needed Work: \$3,500,000.00



PRIMARY FACADE.



MAIN ENTRANCE DETAIL.



REAR ENTRANCE DETAIL.



Name:	OKAN	IOGAN COUNTY COURT	THOUSE	Date of	f Construction: 1913		
Location:	123 5t	h Avenue North, Okanoga	an, WA 98840	Histori	c 🗹 Non-Historic 🗌		
Contact Pers	on:	Dan Powers 509.422.71	04/Jim Weed, County	Administrator			
Contact Pho	ne:	(509) 422-7169	Contact Email:				
Contact Add	ress:	123 5th Avenue North, 0	Okanogan, WA 98840)			
Center of dow	Site Information: Center of downtown Okanogan. County Courthouse is on a sloping face with first floor open to street on east side. Second floor open to street on west side.						
UTM Referen	ices:	Quadrant Name: Okan	ogan	Zone : 11	Scale: 1:25,000		
		Easting: 308807E	Northing: 53599	933N	Datum: NAD 27		
GPS Refence	<u>es:</u>	Latitude: 48.3656N	Longitude:	119.5814W			
Construction	<u>Type:</u>	Stucco over brick walls.	Concrete floors, foun	dation.			

Square Footage:	29,650	EQ Zone: 2	Date of Last Major Rehab:	none
-----------------	--------	------------	---------------------------	------

General Condition:

Good. Recent jail building. Original fir interior woodwork. Mission tile roof. Wood windows in place/ok. Building has had no complete rehabilitation work. We are working on this but lack money to be effective.

Type of Last Major Rehab Work:

1940's addition to north, interior stairs redone, vinyl windows. We are committing a large amount of money and effort to the Courthouse rehab now, i.e. \$370,000 for HVAC this summer. We have repaired and resealed the exterior--community group working on clocks for clock tower. Capitol improvement projects. Need new roof badly. Estimated remodel of Courthouse and Annex \$4.2 million. Original boiler. Need UFE (?) safety help.

General Description of Needed Work:

Really needs complete rehab including new electrical, plumbing, communications systems, roof, security system, windows, HVAC. Needs general preservation recovery.

Estimated Cost of Needed Work: \$4,200,000.00

OKANOGAN COUNTY



PRIMARY FACADE.



REAR ADDITION.

STAIRWAY DETAIL.



Name:	PACI		RTHOUSE	E		Date of	Construc	tion:	1910
Location:	300 N	lemorial Drive, Sou	th Bend, V	VA 98586		Historic	Non-	Histor	ic 🗌
Contact Pers	son:	Randy Wilson/Ed	Kaech, As	sst Dir of Pub	lic Works	S			
Contact Pho	ne:	(360) 875-9368	<u>c</u>	Contact Emai	<u>il:</u> rwils	son@co.paci	ificwa.us		
Contact Add	ress:	PO Box 66, South	n Bend, W	A 98586					
Site Information	tion:								
-	-	site with lawn abov e Meridian NE 1/4 d		-	ay. Towr	nship 14 Nor	th, Range	9 Wes	st,
	marriett			.,					
		Ourselment Name		n d	-		Qualar	1.05.00	20
UTM Referer	ices:	Quadrant Name:			_	one: 10	Scale:	,	
		Easting: 438093	BE	Northing: 5	5167732	N	Datum:	NAD2	27
GPS Refence	<u>es:</u>	Latitude: 46.66	23N	Longit	tude: 12	23.8092W			
Construction	n Type:	Masonry, steel, w	ood.						
<u>Square Foot</u>	age:	25,000 <u>I</u>	EQ Zone:	2	Date of	Last Major	Rehab:	1992	
General Con	dition								

General Condition:

Good. Very well maintained building with original windows and exterior finishes and detailing.

Type of Last Major Rehab Work:

Paid for with bond. Seismic upgrade (reinforced roof/wall). Copper roof (leaking). Exterior; stripped, painted. Sealing of basement. 1980 -- \$150,000 releaded all stained glass.

General Description of Needed Work:

Not energy efficient, HVAC inefficient. Remodeling basement. Windows could be rebuilt. Roof repair. Study by Caldwell Thomas. Re-create Rotunda balustrade. Basement and window repair and retrofit 100K.

Estimated Cost of Needed Work: \$100,000.00

PACIFIC COUNTY



PRIMARY FACADE.



COURTROOM DETAIL.



DOME DETAIL.



Name:	PEND	OREILLE	COUNTY COUR	THOUSE		<u>Date o</u>	f Construct	tion:	1915
Location:	625 W	/est 4th, New	vport, WA 9915	6		Histori	ic 🔽 Non-ł	Histor	ic 🗌
Contact Pers	son:	Neil White,	Dir of Developr	ment & Land	Mgmt				
Contact Pho	ne:	(509) 447-4	4821	Contact Em	ail: n	white@pendo	reille.org		
Contact Add	ress:	PO Box 50	66, Newport, W	A 99156					
Site Informat	tion:								
Main building extension offi		building to r	rear. Small atten	idant building	ı in san	ne design serv	ves as agricu	ultural	
	00.								
		Ourselment	Newser Mouroet			7 11	Ocales 1	.05.00	0
UTM Referer	<u>ices:</u>	-	Name: Newport		50050	Zone: 11	Scale: 1		
		Easting: 4	1900 18E	Northing:	53356	54IN	Datum:	NAD2	27
GPS Refence	<u>es:</u>	Latitude:	48.1779N	Long	itude:	117.0468W			
Construction	n Type:	Brick masc	onry.						
Square Foot	age:	24,000	EQ Zone:	2	Date	of Last Majo	or Rehab:	1992	
General Con	dition:								
Good.									

Type of Last Major Rehab Work:

1992 Renovation, vinyl windows, interior corridors, cosmetic rehab, elevator added-ADA. HVAC 1992 w/ upgrade in 2000.

General Description of Needed Work:

Elevator/ADA structural upgrade 25K. Reroof 40K. Entry area rehab 35K. Exterior sidewalks & sitework10K. Historic Preservation recovery 40K.

Estimated Cost of Needed Work: \$150,000.00

PEND OREILLE COUNTY



PRIMARY FACADE.



MAIN ENTRANCE DETAIL.



WINDOW DETAIL.



Name:	PIERCE COUNTY COURTHOUS	E	Date of Construction:
Location:	930 Tacoma Avenue South, Taco	Historic 🗌 Non-Historic 🔽	
Contact Perso	on:		
Contact Phon	<u>e:</u>	Contact Email:	
Contact Addr	ess:		
Site Informati	<u>on:</u>		

UTM References:	Quadrant Name: Tacoma	Zone: 10	Scale:	1:25,000	
	Easting: 542072E	Northing: 52332	74N	Datum:	NAD27
GPS Refences:	Latitude: 47.2536N	Longitude:	122.4440W		
Construction Type:					
<u>Square Footage:</u>	EQ Zone:	3 Date	of Last Majo	r Rehab:	

General Condition:

Type of Last Major Rehab Work:

General Description of Needed Work:

Estimated Cost of Needed Work: \$0.00

Name:	SAN J	IUAN COUNTY COURTHO	USE	Date of	Construction: 1906
Location:	350 C	ourt Street, Friday Harbor, V	VA 98250	Historie	🛛 🔽 Non-Historic 🗌
Contact Pers	on:	Jon Shannon/Bud Sears, E	Building & Grounds	8	
Contact Pho	ne:	(360) 317-8648	Contact Email:	buds@rockislar	id.com
Contact Add	ress:	PO Box 729, Friday Harbo	r, WA 98250		
Site Informat	ion:				
Landscaped f	lat lot o	n edge of town.			
UTM Referen	ices:	Quadrant Name: Friday H	larbor	Zone: 10	Scale: 1:25,000
		Easting: 498765E	Northing: 5375	5595N	Datum: NAD27
GPS Refence	es:	Latitude: 48.5354N	Longitude	e: 123.0167W	
Construction	<u>Type:</u>	Concrete with brick façade	e. Concrete slab ro	oof.	

Square Footage:5350EQ Zone:3Date of Last Major Rehab:1982

General Condition:

Good. General maintenance plan and system being developed to improve condition of courthouse over time.

Type of Last Major Rehab Work:

1982--seismic retrofit and remodel of office space. 1984--One story addition built. 1990--Second story added to the addition.

General Description of Needed Work:

Main entryway needs to be replaced, overhanging structures need repair, concrete steps need repair \$30,000. Re-roof entire building \$100,000. Replace wood floor on first floor and carpeting on second floor \$30,000. Replace cracks in lath strip and plaster interior wall from earthquake. HVAC is ok. Plumbing is ok. Electrical could use updating.

Estimated Cost of Needed Work: \$200,000.00



PRIMARY FACADE. SOURCE: SAN JUAN COUNTY.



MAIN ENTRANCE DETAIL. SOURCE: SAN JUAN COUNTY.



COURTROOM DETAIL. SOURCE: SAN JUAN COUNTY.



Name:	SKAG		SE	Date of Construction: 1924		
Location:	205 W	Kincaid Street, Mt. Vernor	n, WA 98273	Historic 🔽 Non-Historic 🗌		
Contact Pers	on:	Roger Howard, Facilities Manager				
Contact Pho	ne:	(360) 336-9376	Contact Email:	rogerh@co.skagit.wa.us		
Contact Add	ress:	700 South 2nd, Room 202	2, Mt. Vernon, WA	98273		
Site Information:						
Heart of downtown Mt. Vernon on a flat site.						

UTM References:	Quadrant Name: Mount Ver	non Zone: 10	Scale: 1:25,000
	Easting: 549199E	Northing: 5362732N	Datum: NAD27
GPS Refences:	Latitude: 48.4178N	Longitude: 122.3351V	V
Construction Type:	Light beige brick/sandstone, originally constructed on woo placed on roof (could be calle	d pilings. Carved spandrels a	

Square Footage: 45,000 EQ Zone: 3 Date of Last Major Rehab: 2001

General Condition:

Good to fair. Original wood windows, need paint. Some vinyl/metal on east elevation/some tile infill. Entry, lobby, stairs, and corridors all original configuration. Terrazzo floors. Interior walls with plaster faux stone finish. Top floor west corridor has structural crack from earthquake. No attached buildings. Security utilizes most of entry lobby.

Type of Last Major Rehab Work:

In 2001, remodeled the area for Superior Court Room. In 1993, replaced parapet. In 1996, new concrete foundation.

General Description of Needed Work:

Replace original elevator 50K. General maintenance 450K. Roof replacement 75K. Remove steel jail box from roof 10K. Seismic assessment 25K.

Estimated Cost of Needed Work: \$610,000.00

SKAGIT COUNTY



REAR FACADE.



MAIN ENTRANCE DETAIL.



CORRIDOR DETAIL.



Name:	SKAMANIA COUNTY COURTHO	DUSE	Date of Construction:	1949
Location:	240 NW Vancouver Street, Steve	nson, WA 98648	Historic 🗌 Non-Histori	c 🗸
Contact Perso	on:			
Contact Phon	<u>e:</u>	Contact Email:		
Contact Addr	ess:			
Site Informati	<u>on:</u>			

UTM References:	Quadrant Name: Bonneville Dam		Zone: 10	Scale:	1:25,000
	Easting: 586979E	Northing: 5060	599N	Datum:	NAD27
GPS Refences:	Latitude: 45.6954N	Longitude:	121.8829W		
Construction Type:	Modern Public Works St metal work.	/le concrete with stuc	co cover. Tera	izzo floors	3. Some
Square Footage:	36,000 EQ Zor	e: 2 Date	e of Last Majo	r Rehab:	

General Condition:

Drop ceilings throughout. Windows replaced with bronze.

Type of Last Major Rehab Work:

General Description of Needed Work:

Estimated Cost of Needed Work: \$0.00

SKAMANIA COUNTY



PRIMARY FACADE.



PHOTOGRAPH OF HISTORIC SKAMANIA COUNTY COURTHOUSE.



COLONNADE DETAIL.



Name:	SNOF	IOMISH COUNTY COURT	HOUSE	Date of Construction: 1897/
Location:	3000	Rockefeller Avenue, Everet	t, WA 98201	Historic 🗹 Non-Historic 🗌
Contact Pers	ion:	Alan Kelm, Deputy Direct	or for Facilities	
Contact Pho	ne:	(425) 388-3320	Contact Email:	
Contact Add	ress:	3000 Rockefeller Avenue	, MS 404, Everett, WA 98	201
Site Informat	tion:			
Downtown Ev	erett at	the top of a hill.		

UTM References:	Quadrant Name: Everett	Zone : 10	Scale: 1:25,000
	Easting: 559354E	Northing: 5313954N	Datum: NAD27
GPS Refences:	Latitude: 47.9781N	Longitude: 122.2047W	
Construction Type:	Concrete, brick, hollow clay	tile. Roof framing is wood. Clay	tile roof. Mission style.

Square Footage:	48,000	EQ Zone: 3	Date of Last Major Rehab:	1980
-----------------	--------	------------	---------------------------	------

General Condition:

Built in 1897, burned in 1909, rebuilt in 1911. Needs a lot of work. Stucco cracked at clocktower -- earthquake damage. Windows are original with some metal sash. Main historical entry closed and new addition to north circa 1970. Formal interior entry gone.

Type of Last Major Rehab Work:

Remodel in 1980. Two courtrooms on 2nd floor and added the flat portion of the roof.

General Description of Needed Work:

Roof first. Asbestos abatement in crawl space - very difficult project. HVAC. Electrical upgrade. Window replacement. Interior carpet. Painting/resealing. Seismic evaluation by engineering firm (Skilling, Word, Magnuson; contact: John Hooper) estimated at \$7.6 million. Capital facilities plan exists but has little money.

Estimated Cost of Needed Work: \$9,300,000.00

SNOHOMISH COUNTY



PRIMARY FACADE.



DETAIL OF CONNECTION BETWEEN HISTORIC AND NEW ADDITION.



CORRIDOR DETAIL.



Name:	SPOK		DUSE	Date of Construction: 1895
Location:	1116	N Broadway Avenue, Spol	kane, WA 99260	Historic 🗹 Non-Historic 🗌
Contact Pers	son:	Gary Fuher, Facilities Dir	rector	
Contact Pho	ne:	(509) 477-3419	Contact Email:	gfuher@spokanecounty.org
Contact Add	ress:	1211 W Gardner, Spoka	ne, WA 99260	
Site Informat	tion:			
Relatively flat	. Origin	ally slight roll that was grad	ded out to north. N	lo changes from original site plan.

UTM References:	Quadrant Name: Spokane	NW Zone: 11	Scale: 1:25,000
	Easting: 467892E	Northing: 5278902N	Datum: NAD27
GPS Refences:	Latitude: 47.6647N	Longitude: 117.4277W	
Construction Type:		cornice and decorative elements cluding spire. Rubble stone foun	

EQ Zone: 2B Square Footage: 114,847 Date of Last Major Rehab: 2003

General Condition:

Good to very good. Regular maintenance plan for interior and exterior. Most to all repair and maintenance work done in house.

Type of Last Major Rehab Work:

d. 1893, c. 1895. Condition very good to excellent. Not on Register but building is subject to review by local Landmarks Commission. Structurally in great condition. Maintained original character of building in updates. 1930-40 interior rehab including dark wood paneling, white marble wainscotting on ground floor. Windows replaced in 2000, metal/yellow. Portions of mechanical and electrical systems upgraded. Superior Courts remodeled. One courtroom fully ADA accessible. Elevator remodeled.

General Description of Needed Work:

Complete HVAC/electrical/mechanical/add elevator/general construction work throughout building.

Estimated Cost of Needed Work: \$15,000,000.00

SPOKANE COUNTY



PRIMARY FACADE.



MAIN ENTRANCE DETAIL.



CORRIDOR DETAIL.



Name:	STEV	ENS COUNTY COURTHO	USE	Date of Construction: 1938
Location:	215 S	outh Oak Street, Colville, V	outh Oak Street, Colville, WA 99114	
Contact Pers	ion:	Jim Moffitt, Public Works	Risk Mgmt Dept	
Contact Pho	ne:	(509) 684-4548	Contact Email:	
Contact Add	ress:	185 E Hawthorne, Colville	e, Wa 99114	
Site Informat	tion:			
1973 addition	with di	strict courtroom.		

UTM References:	Quadrant Name: Everett	Zone: 10	Scale: 1:25,000
	Easting: 559344E	Northing: 5313909N	Datum: NAD27
GPS Refences:	Latitude: 47.9777N	Longitude: 122.2048W	
Construction Type:	Brick Art Deco. Linoleum fl baseboards.	oors. Beige terrazo wainscotting.	Turquoise

Square Footage:28,740EQ Zone:2Date of Last Major Rehab:1990

General Condition:

Excellent condition. Small addition on rear and large criminal justice facility on rear side. Original metal windows. Mahogany woodwork/doors.

Type of Last Major Rehab Work:


Steady maintenance.

General Description of Needed Work:

Reroof \$75,000. Masonry cleaning \$65,000. Rehab metal windows \$125,000. HVAC \$250,000.

Estimated Cost of Needed Work: \$515,000.00

STEVENS COUNTY

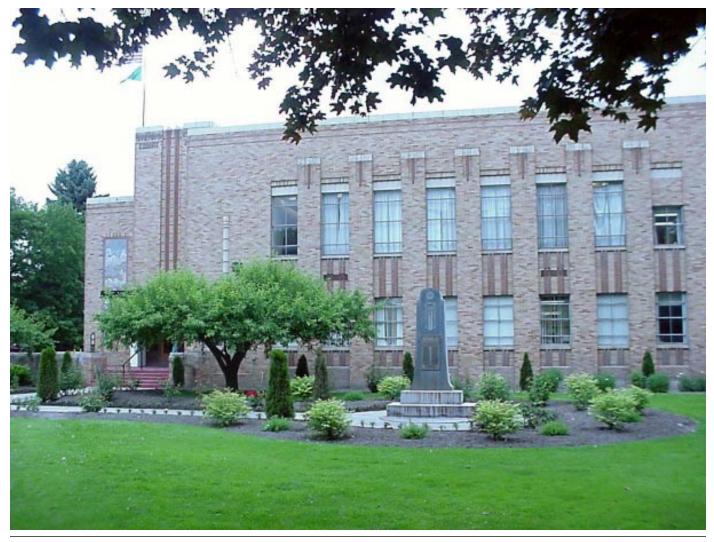

PRIMARY FACADE.



MAIN ENTRANCE DETAIL.



MURAL DETAIL.



THURSTON COUNTY COURTH	OUSE	Date of Construction:
2000 Lakeridge Drive SW, Olymp	ia, Wa 98502	Historic 🗌 Non-Historic 🔽
<u>on:</u>		
<u>1e:</u>	Contact Email:	
ess:		
ion:		
		ne: Contact Email:

UTM References:	Quadrant Name: Tumwate	er Zone: 10	Scale: 1:25,000
	Easting: 506923E	Northing: 5208468N	Datum: NAD27
GPS Refences:	Latitude: 47.0317N	Longitude: 122.9089W	
Construction Type:			
Square Footage:	EQ Zone:	3 Date of Last Maje	or Rehab:
General Condition:			

Type of Last Major Rehab Work:

General Description of Needed Work:

Estimated Cost of Needed Work: \$0.00

Name:	WAH		JNTY COURTH	HOUSE	Da	te of Constr	r <mark>uction:</mark> 1	921
Location:	64 Ma	in Street, Cat	hlamet, WA 98	8612	His	storic 🔽 No	on-Historic	: 🗆
Contact Pers	son:	Charles Bey	ver/Diane Tisch	er, Auditor				
Contact Pho	ne:	(360) 795-3	067	Contact Ema	ail: beyerc@co	o.wahkiakum	.wa.us	
Contact Add	ress:	PO Box 543	, Cathlamet, W	/A 98612				
Site Informa	tion:							
					Street in Cathla y CF Martin in 19		esigned by	
			,					
UTM Referer	ices.	Quadrant N	lame: Cathlam	let	Zone: Ć	10 Scale	: 1:25,000)
	1003.	Easting: 47		Northing:		Datum	,	
GPS Refence	<u>es:</u>	Latitude:	46.2032N	Long	itude: 123.382	5W		
Construction	n Type:	Concrete wi	th stucco finish	1.				
Square Foot	age:	10,800	EQ Zone:	<u>:</u> 2	Date of Last I	<u>Major Rehab</u>	<u>:</u> 1994	
General Con	dition:							
Good								

Type of Last Major Rehab Work:

Substantial remodel from 1991-1994. CSC Architects of Longview, WA. Heating system update, elevator installation, seismic retrofitting, courtroom and court office addition, window replacement, and general interior and exterior upgrades. Cost: \$1.171 million.

General Description of Needed Work:

Historic recovery \$100,000

Estimated Cost of Needed Work: \$100,000.00

Name:	WALL	A WALLA COUNTY COU	Date of Construction: 1915	
Location:	315 W	/est Main Street, Walla Wa	Historic 🔽 Non-Historic 🗌	
Contact Pers	on:	Mike Jacobs, Facilities Mgr.Gordon Heimbiger, Financial Analyst		
Contact Phone:		(509) 527-3202	Contact Email:	mjacobs@co.walla-walla.wa.us
Contact Address:		PO Box 1506, Walla Wall	a, WA 99362	

Site Information:

Large stone clad courthouse on landscaped park site with hall of records building on one flank and sheriff and jail on the other. Rear addition for criminal justice. Very formal building with original interior finishes and detailing inside and out. Rich marble floors, wainscotting, stairs and columns. Coved ceiling with decorative molding details. Interior doors, frames and casings are fireproof sheet metal with faux oak paint in original condition. There are three courtrooms.

UTM References:	Quadrant Name: Walla Walla Zon		Scale: 1:25,000
	Easting: 396188E	Northing: 5101874N	Datum: NAD27
GPS Refences:	Latitude: 46.0645N	Longitude: 118.3422W	1
Construction Type:	Brick masonry.		

Square Footage:	30.000	EQ Zone:	2
oquale i oolaye.	30,000		~

Date of Last Major Rehab: 1996

General Condition:

Excellent with a high degree of original fabric intact. Some inappropriate-design ceiling mounted light fixtures, particularly in courtrooms.

Type of Last Major Rehab Work:

2002 cleaned and repointed upper exterior masonry \$530,000. 2003 Elevator ADA upgrading \$65,000.

General Description of Needed Work:

HVAC, complete system retrofit \$500,000. Replacement of aluminium windows with appropriate wood clad 250K. New roof 75K. Clean and repoint lower exterior masonry \$250,000. Interior finishes \$45,000.

Estimated Cost of Needed Work: \$1,120,000.00

WALLA WALLA COUNTY



PRIMARY FACADE.



COURTROOM DETAIL.

STAIRWAY DETAIL.



Name:	WHATCOM COUNTY COURTHO	OUSE	Date of Construction:
Location:	311 Grand Avenue, Bellingham, V	NA 98225	Historic 🗌 Non-Historic 🔽
Contact Pers	on:		
Contact Phor	<u>ie:</u>	Contact Email:	
Contact Addr	ess:		
Site Informati	ion:		

UTM References:	Quadrant Name: Bellingha	m North Zone: 10	Scale: 1: 25,000
	Easting: 538206E	Northing: 5400070N	Datum: NAD27
GPS Refences:	Latitude: 48.7544N	Longitude: 122.4802W	
Construction Type:			
Square Footage:	EQ Zone:	3 Date of Last Maj	or Rehab:
General Condition:			

Type of Last Major Rehab Work:

General Description of Needed Work:

Estimated Cost of Needed Work: \$0.00

Name:	WHITM	MAN COUN ⁻	TY COURTHO	USE		Date of	of Construction:	1955
Location:	310 No	orth Main, Co	olfax, WA 991	11		Histor	ric 🗌 Non-Histo	oric 🔽
Contact Pers	on:	Tom Miller,	Facilities Man	ager				
Contact Phor	ne:	(509) 397-6	6238	Cont	act Email:			
Contact Add	ress:							
Site Informat	ion:							
Downtown on	main hi	ghway and r	iver. Building h	ias pul	olic safety addi	tion on rear.		
UTM Referen	ces:	Quadrant I	Name: Colfax	North		Zone: 11	Scale: 1:25,0	000
		Easting: 4	72333E	No	rthing: 51919	58N	Datum: NAD	027
GPS Refence	<u>:S:</u>	Latitude:	46.8826N		Longitude:	117.3631W		
Construction	Type:	Brick with c	arved stone er	ntry.				
Square Foota	age:	36,000	EQ Zone	<u>e:</u> 2	Date	of Last Maje	or Rehab: 2003	3
General Cond	dition:							
Excellent with recent HVAC upgrades. Terazzo floors. Aluminum rails. Windows replaced 2003. Metal								
dividers replac	Jeu.							

Type of Last Major Rehab Work:

HVAC retrofit in progress. Widows replaced.

General Description of Needed Work:

General preservation recovery 200K.

Estimated Cost of Needed Work: \$200,000.00

WHITMAN COUNTY



PRIMARY FACADE.



MAIN ENTRANCE DETAIL.



LOBBY DETAIL.



<u>Name:</u>	YAKIMA COUNTY COURTHOUS	SE	Date of Construction:
Location:	128 North 2nd Street, Yakima, Wa	A 98901	Historic 🗌 Non-Historic 🔽
Contact Perso	on:		
Contact Phon	<u>le:</u>	Contact Email:	
Contact Addr	<u>ess:</u>		
Site Informati	on:		
Contact Perso Contact Phon Contact Addr	on: le: ess:		HISTORIC 📋 Non-Historic 🔽

UTM References:	Quadrant Name: Yakima	West Zone: 10	Scale: 1:25,000
	Easting: 691098E	Northing: 5164028N	Datum: NAD27
GPS Refences:	Latitude: 46.6046N	Longitude: 120.5048W	
Construction Type:			
Square Footage:	EQ Zone:	2 Date of Last Maj	or Rehab:
General Condition:			

Type of Last Major Rehab Work:

General Description of Needed Work:

Estimated Cost of Needed Work: \$0.00